



NUMBER: 06-001-08

GROUP: Clutch

DATE: June 14, 2008

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler LLC.

THIS BULLETIN SUPERSEDES TECHNICAL SERVICE BULLETIN 06-004-07, DATED OCTOBER 26, 2007. ALL REVISIONS ARE HIGHLIGHTED WITH **ASTERISKS**** AND INCLUDES A REVISED CLUTCH DISC PART NUMBER.**

SUBJECT:

Squeak-Like Sound Due To Manual Transmission Clutch Disc

OVERVIEW:

This bulletin involves the replacement of the manual transmission clutch disc.

MODELS:

2007 - 2008 (JK) Wrangler

NOTE: This bulletin applies to Wrangler vehicles equipped with a 3.8L engine and manual transmission (sales codes EGT and DEH respectively), built on or before June 5, 2008 (MDH 0605XX).

SYMPTOM/CONDITION:

The customer may experience a squeak-like sound from the transmission clutch. This sound will occur when there is a change in engine torque. The squeak-like sound can be heard most often during: clutch engagement, acceleration (tip-in), and/or deceleration maneuvers. This condition may be due to the clutch disc internal components.

DIAGNOSIS:

If the customer experiences the above condition, and the condition is isolated to the clutch, then perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1	** 52104732AC **	Disc, Clutch

NOTE: ONLY the clutch disc requires replacement.

REPAIR PROCEDURE:

1. Replace the clutch disc:
 - a. Refer to TechCONNECT for detail transmission Service Information repair procedures. From the "Service Info" tab select: 21 - Transmission and Transfer Case > Manual Transfer Case - NSG370 > Removal and Installation.
 - b. Refer to TechCONNECT for detail clutch disc Service Information repair procedures. From the "Service Info" tab select: 6 - Clutch > Disc - Clutch > Removal and Installation.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
06-20-01-90	Disc, Clutch - 4x2 - Replace (B)	2.5 Hrs.
06-20-01-91	Disc, Clutch - 4x4 - Replace (B)	3.5 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------