



**NUMBER:** 06-004-07

**GROUP:** Clutch

**DATE:** October 26, 2007

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler LLC.*

**SUBJECT:**

Squeak-Like Sound Due To Manual Transmission Clutch Disc

**OVERVIEW:**

This bulletin involves the replacement of the manual transmission clutch disc.

**MODELS:**

2007 - 2008 (JK) Wrangler

**NOTE: This bulletin applies to Wrangler vehicles equipped with a 3.8L engine and manual transmission (sales codes EGT and DEH respectively), built on or before February 28, 2008 (MDH 0228XX).**

**SYMPTOM/CONDITION:**

The customer may experience a squeak-like sound from the transmission clutch. This sound will occur when there is a change in engine torque. The squeak-like sound can be heard most often during: clutch engagement, acceleration (tip-in), and/or deceleration maneuvers. This condition may be due to the clutch disc internal components.

**DIAGNOSIS:**

If the customer experiences the above condition, and the condition is isolated to the clutch, then perform the Repair Procedure.

**PARTS REQUIRED:**

Qty.	Part No.	Description
1	52104642AA	Disc, Clutch

**NOTE: ONLY the clutch disc requires replacement.**

**REPAIR PROCEDURE:**

1. Replace the clutch disc:
  - a. Refer to TechCONNECT for detail transmission Service Information repair procedures. From the "Service Info" tab select: 21 - Transmission and Transfer Case > Manual Transfer Case - NSG370 > Removal and Installation.
  - b. Refer to TechCONNECT for detail clutch disc Service Information repair procedures. From the "Service Info" tab select: 6 - Clutch > Disc - Clutch > Removal and Installation.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

<b>Labor Operation No:</b>	<b>Description</b>	<b>Amount</b>
06-20-01-90	Disc, Clutch - 4x2 - Replace (B)	2.5 Hrs.
06-20-01-91	Disc, Clutch - 4x4 - Replace (B)	3.5 Hrs.

**FAILURE CODE:**

ZZ	Service Action
----	----------------