



NUMBER: 08-013-08 REV. A

GROUP: Vehicle Performance

DATE: July 11, 2008

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler LLC.

THIS BULLETIN SUPERSEDES TECHNICAL SERVICE BULLETIN 08-013-08, DATED APRIL 03, 2008. ALL REVISIONS ARE HIGHLIGHTED WITH **ASTERISKS**** AND INCLUDE THE ADDITION OF 2007 AND 2008 MODEL YEAR VEHICLES.**

THE StarSCAN® FLASH FILES FOR THIS BULLETIN MUST BE RETRIEVED FROM THE INTERNET.

StarSCAN® SOFTWARE LEVEL MUST BE AT RELEASE 8.05 OR HIGHER.

StarMOBILE DESKTOP CLIENT -OR- StarMOBILE STANDALONE MODE MAY ALSO BE USED TO PERFORM THE FLASH.

SUBJECT:

FLASH: Oil Change Monitor Alerts Prematurely

OVERVIEW:

This bulletin involves selectively erasing and reprogramming the Powertrain Control Module (PCM).

MODELS:

2007	- 2008 (JK)	Wrangler
**2008	(HB)	Durango **
**2008	(HG)	Aspen **
**2008	(WK)	Grand Cherokee **
**2008	(XK)	Commander **

NOTE: This bulletin applies to **all 2008 HB/HG/WK/XK Models.******

NOTE: **This bulletin applies to 2007 - 2008 JK models equipped with a 3.8L engine (Sales Code EGT) built prior to February 22, 2008 (MDH 0222XX).******

SYMPTOM/CONDITION:

The customer may experience a premature alert of the Oil Change Monitor. This alert is displayed as "CHANGe OIL" on the instrument cluster odometer. This condition may be intermittent or may occur after a battery disconnect has occurred. The customer may be more aware of this condition if the Oil Change Monitor alerts shortly following an oil



Stick with the Specialists™

change.

Do not confuse this condition for an Oil Change Monitor alert due to the Oil Change Monitor not being reset following an oil change.

DIAGNOSIS:

If the above symptom/condition is experienced perform the following repair procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1	04275086AB	Label, Authorized Modification

SPECIAL TOOLS / EQUIPMENT REQUIRED:

NPN	Battery Charger
CH9401	StarSCAN® Tool
CH9404D	StarSCAN® Vehicle Cable
CH9409	StarSCAN® Documentation Kit
CH9410	StarSCAN® Ethernet Cable, 12 ft.
CH9412	StarSCAN® Software Update Device Kit
	TechCONNECT PC or equivalent

REPAIR PROCEDURE - USING THE INTERNET TO RETRIEVE THE FLASH FILE:

NOTE: If this flash process is interrupted/aborted, the flash should be restarted.

1. Reprogram the PCM with the latest software. Follow the detailed service procedures available in DealerCONNECT/TechCONNECT, Refer To Group 8 - Electrical > Electronic Control Modules - Service Information > Module - Powertrain Control > Standard Procedures > PCM/ECM Programming - Gas.
2. Type the necessary information on the "Authorized Modification Label" and attach it near the VECI label.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
18-19-06-C1	Module, Powertrain Control Module (PCM) - Reprogram (B)	0.4 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------