CHRYSLER	SERVICE
Jeep	
() DODGE	

NUMBER:	23-042-06

GROUP: Body

DATE: October 3, 2006

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.

## SUBJECT:

Rear Door Inside And Outside Handles Do Not Function

## OVERVIEW:

This bulletin involves adjusting the door latch adjustment screw.

## MODELS:

2007 (JK) Wrangler Unlimited

#### SYMPTOM/CONDITION:

When trying to open a rear door with the inside remote handle or outside door handle, the door may not open.

#### DIAGNOSIS:

If the vehicle operator describes the above Symptom/Condition, perform the Repair Procedure.

#### PARTS REQUIRED:

Qty.	Part No.	Description
AR	55276821AA	Seal, Latch Adjustment Hole

# REPAIR PROCEDURE:

- 1. If the door will not open, depress and let snap out the outside handle button until the door opens.
- 2. Once the door is open, remove the tape on the door shut face that covers the latch adjust screw hole.
- 3. Insert a 4.0 mm allen wrench into the adjustment screw and rotate the screw 180 degrees counterclockwise to loosen the screw.
- 4. Remove the allen wrench and depress the outside handle button 3 times.
- 5. Reinsert the allen wrench and tighten the adjustment screw to 3.5 Nm (31 in. lbs.). When tightening the adjustment screw it's important that the operator doesn't put a down angle on the tool as a down angle can cause mis-adjustment of the latch to the outside door handle.
- 6. Open and close the door several times using the inside and outside side handles to verify the adjustment is correct.
- 7. Apply a seal, p/n 55276821AA over latch adjust hole.
- 8. Repeat steps 1-7 for the other side if necessary.

Stick with the Specialists<sup>™</sup>

# POLICY:

Reimbursable within the provisions of the warranty.

# TIME ALLOWANCE:

Labor Operation No:	Description	Amount
23-41-01-90	Adjust One or Both Rear Door Latch Adjustment Screws	0.2 Hrs.

#### FAILURE CODE:

	ZZ	Service Action
--	----	----------------